

TESTING

FAULT-FINDING CHART

Anti-creep system does not operate.

Check to ensure that idle speed is correctly adjusted and throttle is returning to its stop.

Disconnect cable from throttle switch. Using ammeter, check circuit for continuity by connecting through meter to earth. All tests with ignition on and wheels stationary.

Amperage shown on meter.
Renew throttle switch.

No amperage shown on meter. Check ignition fuse. If blown, locate fault in ignition auxiliary circuit and repair.

Fuse not blown.

Using voltmeter, test switch side of fuse for continuity.

No current. Check ignition switch terminal for supply. Cable colour, brown and blue.

Supply correct.

Check ignition switch. Renew if faulty.

Ignition switch correct. Replace fuse feed cable. Colour, white.